

	<h1 style="margin: 0;">TECHNICAL BULLETIN</h1> <h2 style="margin: 0;">AC - 08</h2>
---	--

DATE: FEBRUARY 14, 2001
MODEL YEAR: 1999 AND AFTER
CHASSIS MODEL: UD1200/UD1400/UD1800CS
ENGINE MODEL: FD46TA
BULLETIN #: AC-08
FILE IN THE ACCESSORIES SECTION OF THE TECHNICAL BULLETIN BINDER

ZEXEL AIR CONDITIONER CONDENSER FAN RELAY SUB-HARNESS


PURPOSE

To announce the availability of an air conditioner condenser fan relay sub-harness for use in 1999 model year and later UD1200, UD1400 and UD1800CS whenever the condenser fan relay in the Zexel air conditioning system requires replacement.

SERVICE NOTICE

Analysis of failed condenser fan relays indicate that the armature contacts may oxidize which may result in the loss of electrical power to the condenser fan motor. Whenever this condition occurs, the air conditioning quits cooling due to the loss of condenser fan motor operation.

It is recommended to install the condenser fan relay sub-harness whenever the relay is replaced. Install the sub-harness between the chassis harness connectors and the relay. When installed, the sub-harness becomes a jumper between the chassis harness and the relay.

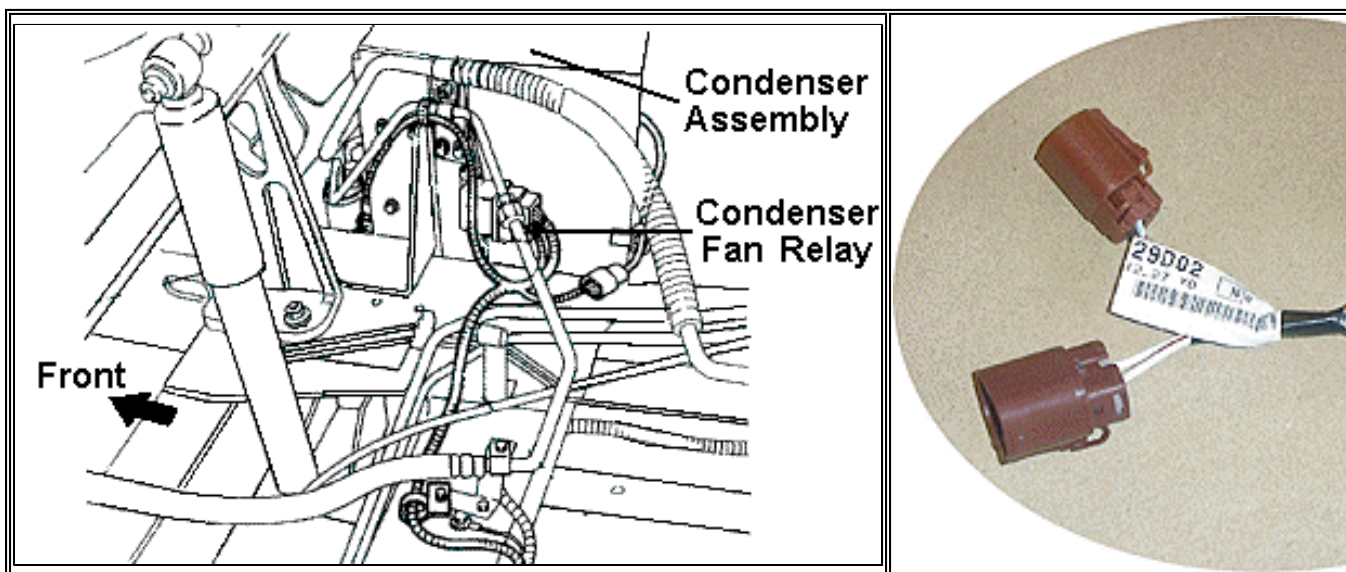

PARTS NOTICE

The part numbers for the condenser fan relay and sub-harness are shown below.

ORIGINAL PART NUMBER:	25230-0T001	Condenser Fan Relay
NEW PART NUMBER:	24004-29D02	Sub-harness

**THE INFORMATION CONTAINED IN THIS BULLETIN SHOULD NOT BE INTERPRETED
AS THE BASIS FOR WARRANTY CLAIMS**