


DATE: JULY 30, 1998
MODEL YEAR: 1995 ~ 1998
CHASSIS MODEL: UD1800 ~ UD3000
ENGINE MODEL: FE6TA
BULLETIN #: GE - 17
FILE IN THE GENERAL SECTION OF THE TECHNICAL BULLETIN BINDER

INJECTION PUMP COUPLER BOLT TORQUE CORRECTION

CORRECTION NOTICE:

The 1995 ~ 1998 UD Service Manual for the UD1800 ~ UD3000 (Pub. No. SMMLPU4E00) requires correction to the indicated page as follows:

- Page DR-6-9, Step 8, *incorrectly* states the injection pump coupler bolt torque as:
T : 22 ~ 25 ft·lb (29 ~ 34 N·m) (3.0 ~ 3.5 kg·m).

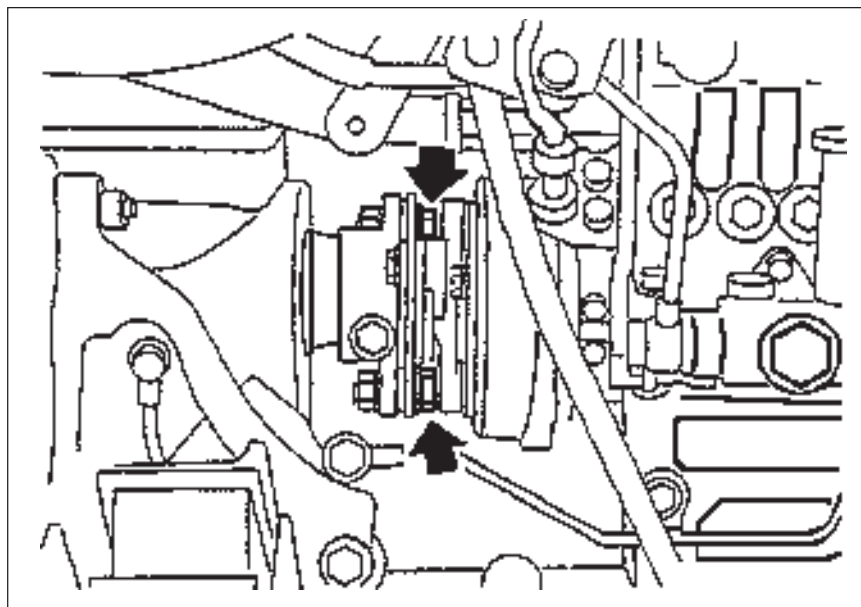

- The *correct torque* for the injection pump coupler bolt, as indicated on page MA-5-10, should be:
T : 43 ~ 47 ft·lb (59 ~ 64 N·m) (6.0 ~ 6.5 kg·m).

RECOMMENDATION:

Dealers are instructed to make the necessary changes to page DR-6-9, Step 8, to reflect the correct injection pump coupler bolt torque as referenced above.