

Trucks

Date	Group	No.	Release	Page
02/14	284	035	001	1(4)

Engine Software Update

GH7 ENG 2011, 2012 and 2013 MY UD-MD

FSB 284-035 Engine Software Update

(February 2014)

UD Trucks has authorized an engine software update that addresses the following items.

- 1. DOC face clogging.
- 2. Injector out of calibration.
- 3. Soot Bar behavior change during manual regeneration.

Verification Update is Required

Verify through the Vehicle Service Notification screen of the UD IntraNET system that the update is required.


Items		Correction		
1	DOC face clogging.	Extend manual forced regeneration mode for 4min during AHI fuel purge operation. (detailed explanation on page 2)		
2	Injector out of calibration.	Engine warning lamp lights up and fault code indicate in cluster when this error occurs.		
3	Soot bar behavior change during manual forced regeneration.	Soot bar remain until manual forced regeneration is completed.		

Service personnel: Please circulate, read and initial

Service Manager	Warranty Adminis- trator	Workshop Foreman	Service Technicians						



Explanation of Software Update:

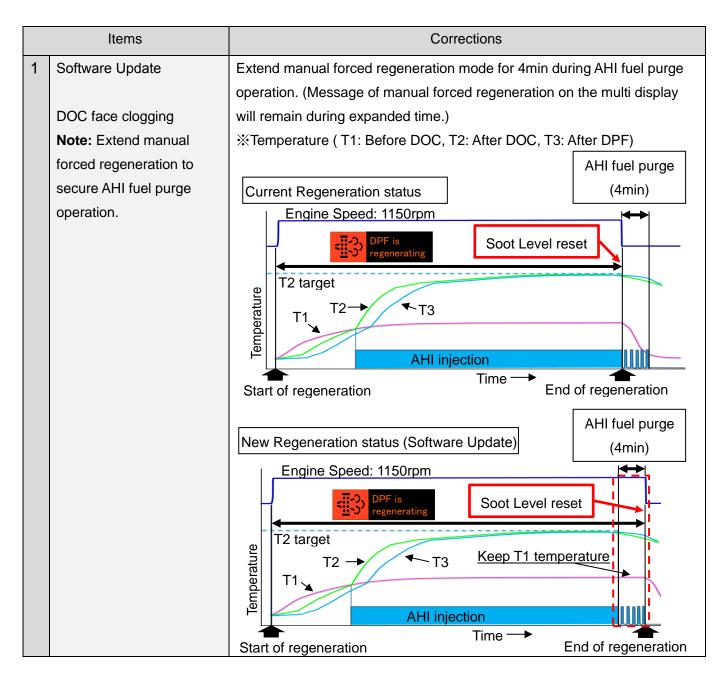

Procedure:

Program MID128 - available date W1350. Verify software after update.



[New MID128 software list]

S10 2011MY (C# 10000~14999)		Part Number
MSW		22322225
CSW	245HP	22279128
	280HP	22279129
	245HP+Continuously Air injection with air regulator	22279130
	280HP+Continuously Air injection with air regulator	22279131
DST1	245HP	22279138
	280HP	22279139
DST2		22270726

610 2012	MY (C# 15000~19999)	Part Number
MSW		22322225
CSW	245HP	22279133
	280HP	22279134
	245HP+Continuously Air injection with air regulator	22279135
	280HP+Continuously Air injection with air regulator	22279136
DST1	245HP	22279140
	280HP	22279141

S10 2013MY (C# 20000~)		Part Number
MSW		22322255
CSW	245HP	22279122
	280HP	22279123
	245HP+Continuously Air injection with air regulator	22279124
	280HP+Continuously Air injection with air regulator	22279125
DST1	245HP	22279126
	280HP	22279127
DST2		22270715

UD TRUCKS		

Date	Group	No.	Release	Page
02/14	284	035	001	4(4)

Reimbursement

Warranty Code	K753
Trouble Code	53500376
Failed Part Number	
Failed Part Name	
Labor Rate	
Reprograming Software	1 hours/unit
Operation Code	919G
Parts Disposition Dispose of removed parts following local regulations	

No additional parts or labor will be accepted when submitting the K753.

UD Trucks North America engages in a comprehensive program of testing and evaluating to provide the best possible product. UD Trucks North America however, is not committed to, or liable for updating existing vehicles.